

Applies To: 2006–09 Civic Hybrid – ALL

April 7, 2009

2006-09 Civic Hybrid: New DTCs U0301, U0302, and U0312

Three DTCs have been added for 2006–09 Civic Hybrids. These DTCs are not yet listed in the service manual, and their descriptions are not in the HDS.

Here are the new DTCs (SAE and Honda codes), their SAE descriptions, and their causes:

SAE DTC (Honda DTC)	SAE Description	Cause
U0301 (195-1)	Software incompatibility with ECM/PCM	The PGM-FI software needs to be updated.
U0302 (195-2)	Software incompatibility with transmission control module	The CVT software needs to be updated.
U0312 (195-18)	Software incompatibility with battery energy control module A	The IMA battery software needs to be updated.

On 2006-09 Civic Hybrids, the latest software version for the PGM-FI, CVT, and IMA battery systems requires that all systems have the most recent software updates. Because of this, updating one system causes one or more other systems to set a DTC when you turn the ignition switch to LOCK (0) and then to ON (II). The DTC(s) cannot be cleared until all the systems are updated.

Update all systems as needed, turn the ignition switch to LOCK (0) and then to ON (II), then clear all DTCs with the HDS.

© 2009 American Honda Motor Co., Inc. - All Rights Reserved

ATB 41446 (0904)

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

